Barber Coleman 7 Series   F to C

<u>Configuration:</u>

1) Remove Control from the case.

2) Open switch V2 and install control back into the case.

3) Press *Function* key to scroll through parameter.

4) Press *Raise* or *Lower* key to change parameter.

<u>Parameter List</u>

P1	=	9	Change to 1
P2	=	0	
P3	=	999	Change to 800
P4	=	r	
P5	=	5	
P6	=	oil	
P7	=	n/a	
P8	=	n/a	
P9	=	0	
P10	=	0	
P11	=	10	
P12	=	10	
P13	=	n/a	

5) Press *Function* key.

6) Press *Raise* or *Lower* key and enter 219.

7) Press *Function* key

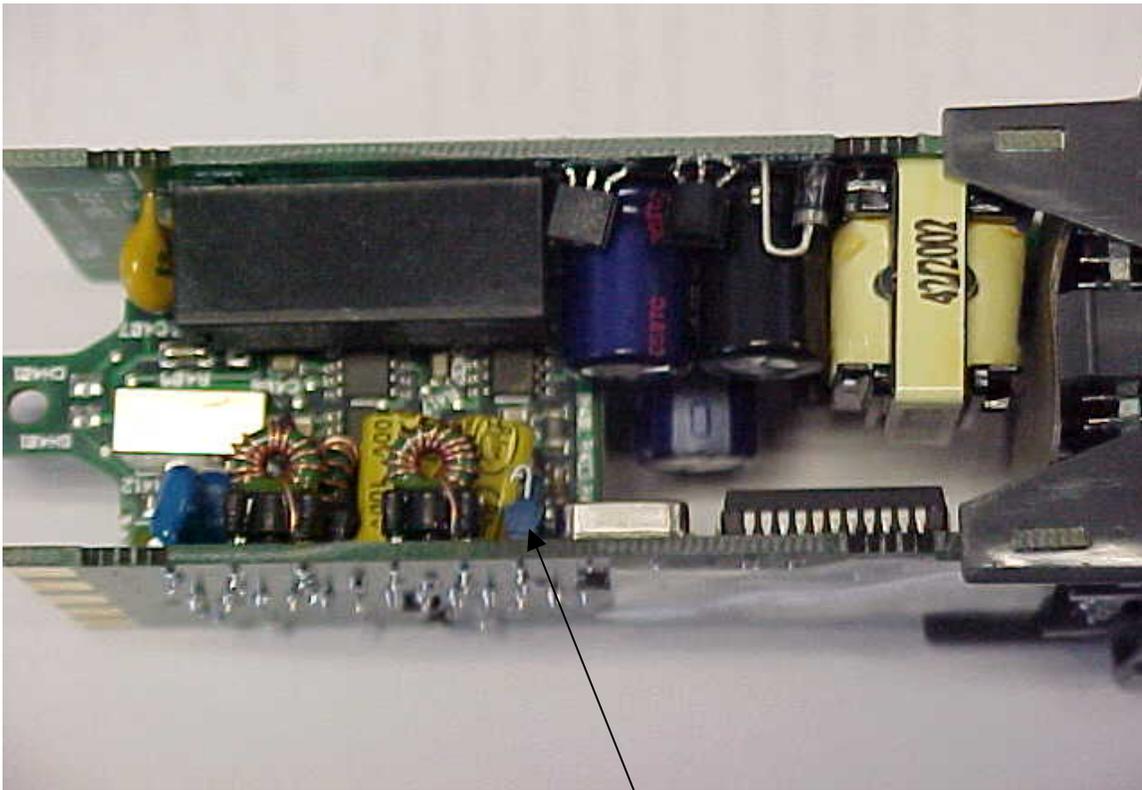|		
P14	=	off
P15	=	1
P16	=	30.0
P17	=	1.0
P18	=	1.5
P19	=	on
P20	=	0.3
P21	=	10

End of configuration mode.

OVER

8) Remove control from case.

9) Close switch V2 and install control back into the case.

10) Press *Raise* or *Lower* key for normal display operation mode.

11) Press *Function* key between each parameter.

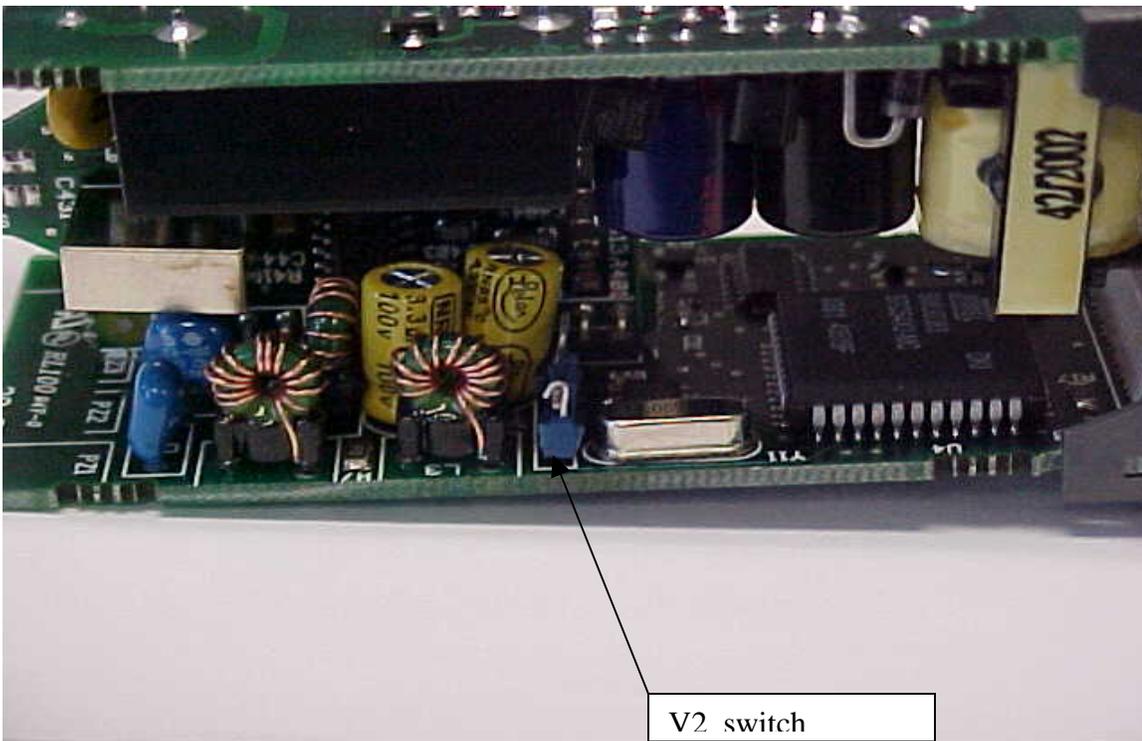|			
SP	=	4-121	
nnn	=	on	**Enter 10**
AL	=	n/a	
Pb	=	4.0	
HS	=	1.0	
Ti	=	4	
Td	=	1	
ip	=	0	
c	=	60	
c2	=	5	
rc	=	1.0	
oLp	=	0	
rL	=	40	**Change to 4**
rH	=	250	**Change to 121**
oLH	=	100	
toL	=	1nf	

12) **Return to nnn- enter 2 to change nnn to ON. Press Function key for normal display**

13) To Auto Tune:

    a) Raise set point to 121 degrees C - wait 3 seconds -

    b) Push and hold *Auto Tune* key until Auto Tune light flashes. Auto Tune light will light solid when tuning is complete.

    c) Push and hold the *Auto Tune* key until the Auto Tune light goes out.

V2 switch

V2 switch